Westralian WD Diesel

ACN: 108 930 089 ABN: 64 108 930 089 MOB: 0418 920 89 OFFICE: 08 6363 561

155 Milner Roa Forrestfield WA 605

PO Box 10: Kalamunda WA 69:

PLEASE PAY BY

AMOUNT

INVOICE DATE

08/08/2023

08/08/2023

TAX INVOICE NO. 74387

Order No.:

Job No.: 34171 Invoice Terms: COD

ABN:

Work overview:

- Inspect and report faults found on three gensets.

All Used Equipment

Welshpool WA 6106

230-232 Welshpool Road

- Load test three gensets.
- Repair electrical faults found across the three gensets.

Faults and issues found:

UON LC150C

- The alternator to the main switch busbars are missing.
- The controller has lost communication with ECU.
- The fuel level sender is faulty.
- The main switch is able to reset after an earth leakage fault, this means the main switch can be closed under fault conditions. This will be a programming issue.
- The 2A circuit breaker on the genset control circuit is missing and has been replaced with a blade fuse.
- The alternator output voltage is unstable at the controller.

Work completed:

HEAVY DUTY EQUIPMENT

-mining -automotive

-power generation

NACCIONA NACCIONAL DECISA SOLUTION AND INCOME DISCO

Westralian WD Diesel

ACN: 108 930 089 ABN: 64 108 930 089 MOB: 0418 920 89 OFFICE: 08 6363 561

155 Milner Roa Forrestfield WA 605

PO Box 10: Kalamunda WA 69:

08/08/2023

AMOUNT

08/08/2023

TAX INVOICE NO. 74387

UON LC150C:

- Installed 95mm2 SDI cables from the alternator to the main switch.
- Inspected the can link to identify why there is no communication between the ECU and the controller. Found some loose wiring on the engine

harness and a plug not inserted properly.

- Removed the fuel level input from the controller programming as requested by the customer.
- Replaced the missing 2A circuit breaker from the control power circuit.
- Investigated the unstable voltage at the controller and narrowed it down to a faulty circuit breaker on the voltage sensing wires. Replaced the 3 pole

circuit breaker that protects the sensing wires and cleared the fault.

- Connected the load bank and load tested the genset.
- Completed the load test data sheet.
- Disconnected the load bank.
- Investigated the earth leakage issue with being able to reset the main switch during its cooldown cycle. Removed the controller and returned to the

workshop for programming as the controller does not have the communication card installed needed to program it. Upgraded the firmware in the

controller to the latest version. Reviewed the program and found the earth leakage input parameter set incorrectly, changed the parameter to the

correct value and re-installed the controller. The earth leakage is now tripping as it should and cannot be reset under fault conditions.

- Carried out the electrical testing and completed the electrical test sheet.
- Re-fitted all of the covers.

All work has been carried out in accordance with Australian electrical standards, rules and regulations.

Part #		Item	Quantity	Unit Price	Total
	Electrician Labou		1.00	A / 1997	
	MAX9 MCB 1P C	2A BOODA			

HEAVY DUTY EQUIPMENT

-mining -a

g -automotive

-power generation

Westralian WD Diesel

ACN: 108 930 089 ABN: 64 108 930 089 MOB: 0418 920 89 OFFICE: 08 6363 561

155 Milner Roa Forrestfield WA 605

PO Box 10: Kalamunda WA 69:

PLEASE PAY BY

AMOUNT

INVOICE DATE

08/08/2023

08/08/2023

TAX INVOICE NO. 74387

Part #	ltem	Quantity	Unit Price	Total
		100	\$50.00	
	9 TALICOPE TO HILE LABOR E	5.00		6.19
	CIRCUIT BABA LACTUG 95MAL MARS TOD	4.00	10.20	
	CUTTUG 95MM2 10MM STUD	4.00		
	Marachal housing	1.00	\$207.18	
	\$	1.00		
		Sub-Total ex GST		

Sub-Total ex GST

GST

INVOICE NO. 74387

Total inc GST

Amount Applied

Balance Due

Please forward a Remittance Advice to accounts@westdiesel.com.au

How To Pay

Credit Card (MasterCard or Visa)

Please call 08 6363 5617 to pay over the phone.

Direct Deposit

Bank ANZ

Acc. Name Maximor Nominees Pty Ltd

BSB **016341**

Acc. No. **376259029** SWIFT **ANZBAU3M**

PERTH METROPOLITAN AND STATE WIDE

HEAVY DUTY EQUIPMENT

-mining

-automotive

-power generation

